

R&R[®] Rancast[™] Investment

Mix 100 parts R&R RANCAST investment powder to 38 parts water by weight. Mechanically mix for 2-3 minutes. Vacuum the mix until the investment rises and breaks to eliminate entrapped air.

Pour the investment down the side of the flask, or mold frame, until the patterns are covered to a depth of approximately 1" (2.5 cm). Vibrate or vacuum the mold to remove air bubbles, which may tend to adhere to the patterns. This operation normally takes 1 to 1½ minutes. Top off the flask with investment and allow to set for 2 hours before starting wax removal and burnout.

Re-usable Patterns

After waiting a minimum of 1 hour, re-usable patterns can be physically removed from the mold.

Wax Patterns

Two methods of wax removal are commonly used: dry dewax and steam dewax. For dry dewaxing, place the mold into a kiln or furnace at a temperature of 300°F-350°F (149°C-177°C) and hold for 3-4 hours. For steam dewaxing, place the mold into the steam dewaxer. Steam dewax only for the time required to remove the wax and no longer. The amount of time required to dewax the molds will vary depending on the size of the mold. After steam dewaxing, immediately place the mold into a furnace at a temperature of 300°F-350°F (149°C-177°C) and hold for 3-4 hours.

After the mold is dewaxed, raise the temperature to 1300°F-1350°F (704°C-732°C) at a rate of 150°F-200°F (66°C-93°C) per hour. Hold the molds at this temperature until the pattern material is completely eliminated. Burnout will take approximately 5 hours at this temperature, although the time will vary depending upon furnace loading and flask size.

After burnout, the molds should be cooled in the furnace to the desired casting temperature. This is normally 400°F-550°F (204°C-288°C) for aluminum and 800°F-1000°F (427°C-538°C) for copper based alloys.

US: Danger. May cause cancer by inhalation. Causes damage to lungs through prolonged or repeated exposure by inhalation. Contains crystalline silica. See SDS for more information.

EU: Danger. Causes damage to lungs through prolonged or repeated exposure. Contains respirable crystalline silica. See SDS for more information.

As the conditions or methods of use are beyond our control, we do not assume any responsibility and expressly disclaim any liability for any use of this product. Information contained herein is believed to be true and accurate but all statements or suggestions are made without warranty, expressed or implied, regarding accuracy of the information, the hazards connected with the use of the material or the results to be obtained from the use thereof. Compliance with all applicable federal, state, and local regulations remains the responsibility of the user. All potential liability related to the sale and use of this product is limited to the cost of the particular goods sold in their respective transactions.



RANSOM & RANDOLPH

Maumee, OH 43537 USA

Toll Free: 800.800.7496

Phone: 419.865.9497

Fax: 419.865.9997

www.ransom-randolph.com

Issue Date: 030717 / Replaces: 092316